REDACTED

SITE: V.C. Chemical Social Cir
BREAK: 2.2
OTHER: v.22

BBL®
BLASLAND, BOUCK & LEE, INC.
engineers, scientists, economists

Transmitted Via First Class Mail

December 9, 2005

[redacted]
507 Dove Way
Social Circle, GA 30025

Re: Soil Sampling Data Summary Report for
507 Dove Way, Social Circle, GA
BBL Project #: 85533

Dear [redacted]

On August 30, 2005 and with your permission, Blasland, Bouck & Lee, Inc. (BBL) collected soil samples from your property located at 507 Dove Way in Social Circle, Georgia. These activities were performed on behalf of Exxon Mobil Corporation (ExxonMobil) to provide data to evaluate the potential impacts of a former fertilizer manufacturing plant whose facilities appear to have been located in the vicinity of the property.

All soil samples collected were tested in the field to determine the approximate levels of arsenic and lead, which research has shown may be related to past operations of the former fertilizer plant. Based on these field test results, select samples were submitted to, and analyzed by, a laboratory approved by the United States Environmental Protection Agency (USEPA).

The purpose of this letter is to describe the soil sampling activities that were performed at your property and to present the results. Also included are photos of the inspection that was performed to document the condition of your property at the time of sampling (Attachment 1). Copies of this report are being submitted to the USEPA.

Soil Sample Collection Activities

Prior to sampling, the locations of underground utilities were identified by a utility locating service to minimize the possibility of disrupting services to the property and protect the safety of the workers.

Two types of soil samples were collected from your property as follows:

- Surface soil samples were collected from 0 to 6 inches below ground surface from five locations in both the front and back yards. The five front yard surface samples were mixed together in equal amounts and then tested in the field to determine the approximate concentrations of arsenic and lead. Field testing was performed using a portable X-ray fluorescence (XRF) device. The front yard mixed sample was then sent to the laboratory for analysis. This process was repeated for the five backyard samples. All samples submitted to the laboratory were analyzed for metals (including arsenic and lead) and pH (soil acidity).

3700 Regency Parkway, Ste. 140 • Cary, NC 275118574
Tel (919) 469-1952 • Fax (919) 469-5676 • www.bbl-inc.com • offices nationwide

- Deeper soil samples were collected from one location in the front yard and one location in the back yard. The locations of these deeper soil samples are shown on Figure 1. At each location, soil samples were collected from 0.5 to 2 feet, 2 to 4 feet, 4 to 6 feet, and 6 to 8 feet below ground surface. These samples were tested in the field using the XRF device described above to determine the approximate concentrations of arsenic and lead. Based on these results, select samples were sent to the laboratory and analyzed for metals (including arsenic and lead) and pH (soil acidity).

A list of the soil samples collected from your property is provided in Table 1.

Results of the Soil Sampling

The USEPA has established screening levels (i.e., levels that trigger additional assessment and evaluation) for metals. Field measurements and laboratory analytical results indicate that the concentrations of arsenic and lead are below the USEPA's screening levels of 27 milligrams per kilogram (mg/kg) and 400 mg/kg, respectively. Laboratory analytical results indicate that iron and vanadium were detected above the USEPA screening levels in the samples collected from your property. Laboratory analytical results for the soil samples collected from your property are provided in Table 2.

Conclusion

As described above, all soil samples collected at your property contained concentrations of arsenic and lead **below** USEPA's screening levels of 27 mg/kg and 400 mg/kg, respectively. According to USEPA, the arsenic and lead concentrations are protective of human health and the environment. Laboratory analytical results indicate that iron and vanadium were detected above the USEPA screening levels in the samples collected from your property. ExxonMobil is submitting these results to the USEPA. We will work with these agencies to determine what further actions (if any) are necessary for your property, and will keep you informed. Any necessary actions for your property will be described in the upcoming *Removal Action Delineation Report/Removal Action Work Plan* that will be prepared by BBL on behalf of ExxonMobil and reviewed and approved by USEPA. This plan will be prepared upon completion of all sampling activities required by USEPA.

Thank you once again for granting ExxonMobil access to your property to conduct these soil sampling activities.

Sincerely,

BLASLAND, BOUCK & LEE, INC.

Information Redacted pursuant to 5 U.S.C. Section 552 (b)(6), Personal Privacy

Geoffrey G. Germann, P.E.
Senior Engineer II

GGG/cbc

Exemption 7 ___ (A) Interference with Enforcement Proceedings
___ (B) Right to Fair Trial
X (C) Unwanted Invasion of Personal Privacy

Enclosures:
Table 1 – Summary of Analytical Program for Samples Collected from 507 Dove Way
Table 2 – Summary of Analytical Results for Detected Metals in Soil Samples Collected from 507 Dove Way
Figure 1 – Sample Location Map for 507 Dove Way

Attachments:
Attachment 1 – Photographs

cc: D. Andrews, USEPA
B. Frink, ExxonMobil
R. Wallis, ExxonMobil
M. Ross, ExxonMobil

Information Redacted pursuant to 5 U.S.C. Section 552 (b)(6), Personal Privacy

Exemption 7 ____ (A) Interference with Enforcement Proceedings
____ (B) Right to Fair Trial
__X__ (C) Unwanted Invasion of Personal Privacy

Tables

BBL®
BLASLAND, BOUCK & LEE, INC.
engineers, scientists, economists

Table 1
Summary of Analytical Program for Samples Collected from 507 Dove Way
Social Circle, Georgia

Sample Name	Depth (feet)	Sample Date	Arsenic and Lead Field Measurement	Laboratory Measurement: Metals	Laboratory Measurement: pH	Comments
Front Yard Samples						
SCSB-507DW-1	0-0.5	08/30/05	X	X	X	Combination (composite) surface soil sample of five locations from the front yard.
SCSB-507DW-1	0.5-2	08/30/05	X	X	X	Soil sample collected from the front yard
SCSB-507DW-1	2-4	08/30/05	X	X	X	Soil sample collected from the front yard
SCSB-507DW-1	4-6	08/30/05	X			Soil sample collected from the front yard not analyzed because arsenic and lead in the 2-4 foot interval were below USEPA screening levels.
SCSB-507DW-1	6-8	08/30/05	X			Soil sample collected from the front yard not analyzed because arsenic and lead in the 2-4 foot interval were below USEPA screening levels.
Back Yard Samples						
SCSB-507DW-2	0-0.5	08/30/05	X	X	X	Combination (composite) surface soil sample of five locations from the back yard.
SCSB-507DW-2	0.5-2	08/30/05	X	X	X	Soil sample collected from the back yard
SCSB-DUP-17	0.5-2	08/30/05		X	X	Duplicate sample of SCSB-507DW-2 (0.5-2)
SCSB-507DW-2	2-4	08/30/05	X	X	X	Soil sample collected from the back yard
SCSB-507DW-2	4-6	08/30/05	X			Soil sample collected from the back yard not analyzed because arsenic and lead in the 2-4 foot interval were below USEPA screening levels.
SCSB-507DW-2	6-8	08/30/05	X			Soil sample collected from the back yard not analyzed because arsenic and lead in the 2-4 foot interval were below USEPA screening levels.

Notes:
1. Samples depths are measured in feet below ground surface.
2. Laboratory measurements were performed by TestAmerica, Inc. of Nashville, Tennessee.
3. Sample locations are shown on Figure 1.

Table 2
Summary of Analytical Results for Detected Metals in Soil Samples Collected from 507 Dove Way
Social Circle, Georgia

Analyte	Screening Level	Units	Concentration in Sample: SCSB-507DW-1 0.5 - 2 ft bgs 8/30/2005	SCSB-507DW-1 0 - 0.5 ft bgs 8/30/2005	SCSB-507DW-1 2 - 4 ft bgs 8/30/2005	SCSB-507DW-2 0.5 - 2 ft bgs 8/30/2005	SCSB-507DW-2 -DUP 0.5 - 2 ft bgs 8/30/2005
Metals							
Aluminum	76000	mg/kg	21600 J	12900 J	12000 J	15100 J	13200 J
Antimony	31	mg/kg	11.4 U	1.56 J	12 U	1.26 J	11.9 U
Arsenic	27	mg/kg	6.6	3.81	3.4	2.79	3.96
Barium	5400	mg/kg	24.3	38.5	13.3	52.4	49.1
Cadmium	37	mg/kg	1.67	0.79 J	1.44	0.727 J	0.696 J
Calcium	--	mg/kg	282	444	25.1	322	293
Chromium	210	mg/kg	41.3 J	21.8 J	36.5 J	29.2 J	21.7 J
Cobalt	900	mg/kg	2.51	2.67	3.59	3.83	3.53
Copper	3100	mg/kg	31.5	16.1	25.9	15.6	14.4
Iron	23000	mg/kg	54500	24700	46400	24800	25000
Lead	400	mg/kg	13.2	9.59	13.8	11.6	10.1
Magnesium	--	mg/kg	196	360	183	288	250
Manganese	1800	mg/kg	125	162	216	265	295
Mercury	23	mg/kg	0.0627 J	0.0928 J	0.116 U	0.0443 J	0.0481 J
Nickel	1600	mg/kg	3.24	3.72	7.82	4.14	3.05
Potassium	--	mg/kg	277	418	300	329	276
Selenium	390	mg/kg	2.72 J	2.34 UJ	2.4 UJ	2.42 UJ	2.38 UJ
Vanadium	78	mg/kg	87.7	41.1	73.5	41.8	41.5
Zinc	23000	mg/kg	20.2	18.6	15.6	21.9	20.6
Miscellaneous							
% Dry Solids	--	%	83.7	85.6	83.4	82.7	84
pH	--	pH Units	6.0	5.2	5.0	5.7	5.6

Notes:
bgs - below ground surface
J - estimated value
mg/kg - milligrams per kilogram
U - not detected
-- no screening level
Shaded value exceeds the screening level

Table 2
Summary of Analytical Results for Detected Metals in Soil Samples Collected from 507 Dove Way
Social Circle, Georgia

Analyte	Screening Level	Units	Concentration in Sample: SCSB-507DW-2 0 - 0.5 ft bgs 8/30/2005	SCSB-507DW-2 2 - 4 ft bgs 8/30/2005
Metals				
Aluminum	76000	mg/kg	12900 J	19700 J
Antimony	31	mg/kg	11.3 U	1.92 J
Arsenic	27	mg/kg	4.37	6.29
Barium	5400	mg/kg	69.9	30.6
Cadmium	37	mg/kg	0.653 J	0.841 J
Calcium	--	mg/kg	292	315
Chromium	210	mg/kg	74.1 J	29.8 J
Cobalt	900	mg/kg	5.7	2.06
Copper	3100	mg/kg	13.5	19
Iron	23000	mg/kg	21800	30900
Lead	400	mg/kg	10.9	12.8
Magnesium	--	mg/kg	312	307
Manganese	1800	mg/kg	271	90.8
Mercury	23	mg/kg	0.049 J	0.0566 J
Nickel	1600	mg/kg	6.98	3.72
Potassium	--	mg/kg	314	347
Selenium	390	mg/kg	2.25 UJ	2.41 UJ
Vanadium	78	mg/kg	36.3	54.2
Zinc	23000	mg/kg	20.5	22.1
Miscellaneous				
% Dry Solids	--	%	85.1	83.1
pH	--	pH Units	5.7	5.6

Notes:
bgs - below ground surface
J - estimated value
mg/kg - milligrams per kilogram
U - not detected
-- no screening level
Shaded value exceeds the screening level

Figure

BBL®
BLASLAND, BOUCK & LEE, INC.
engineers, scientists, economists

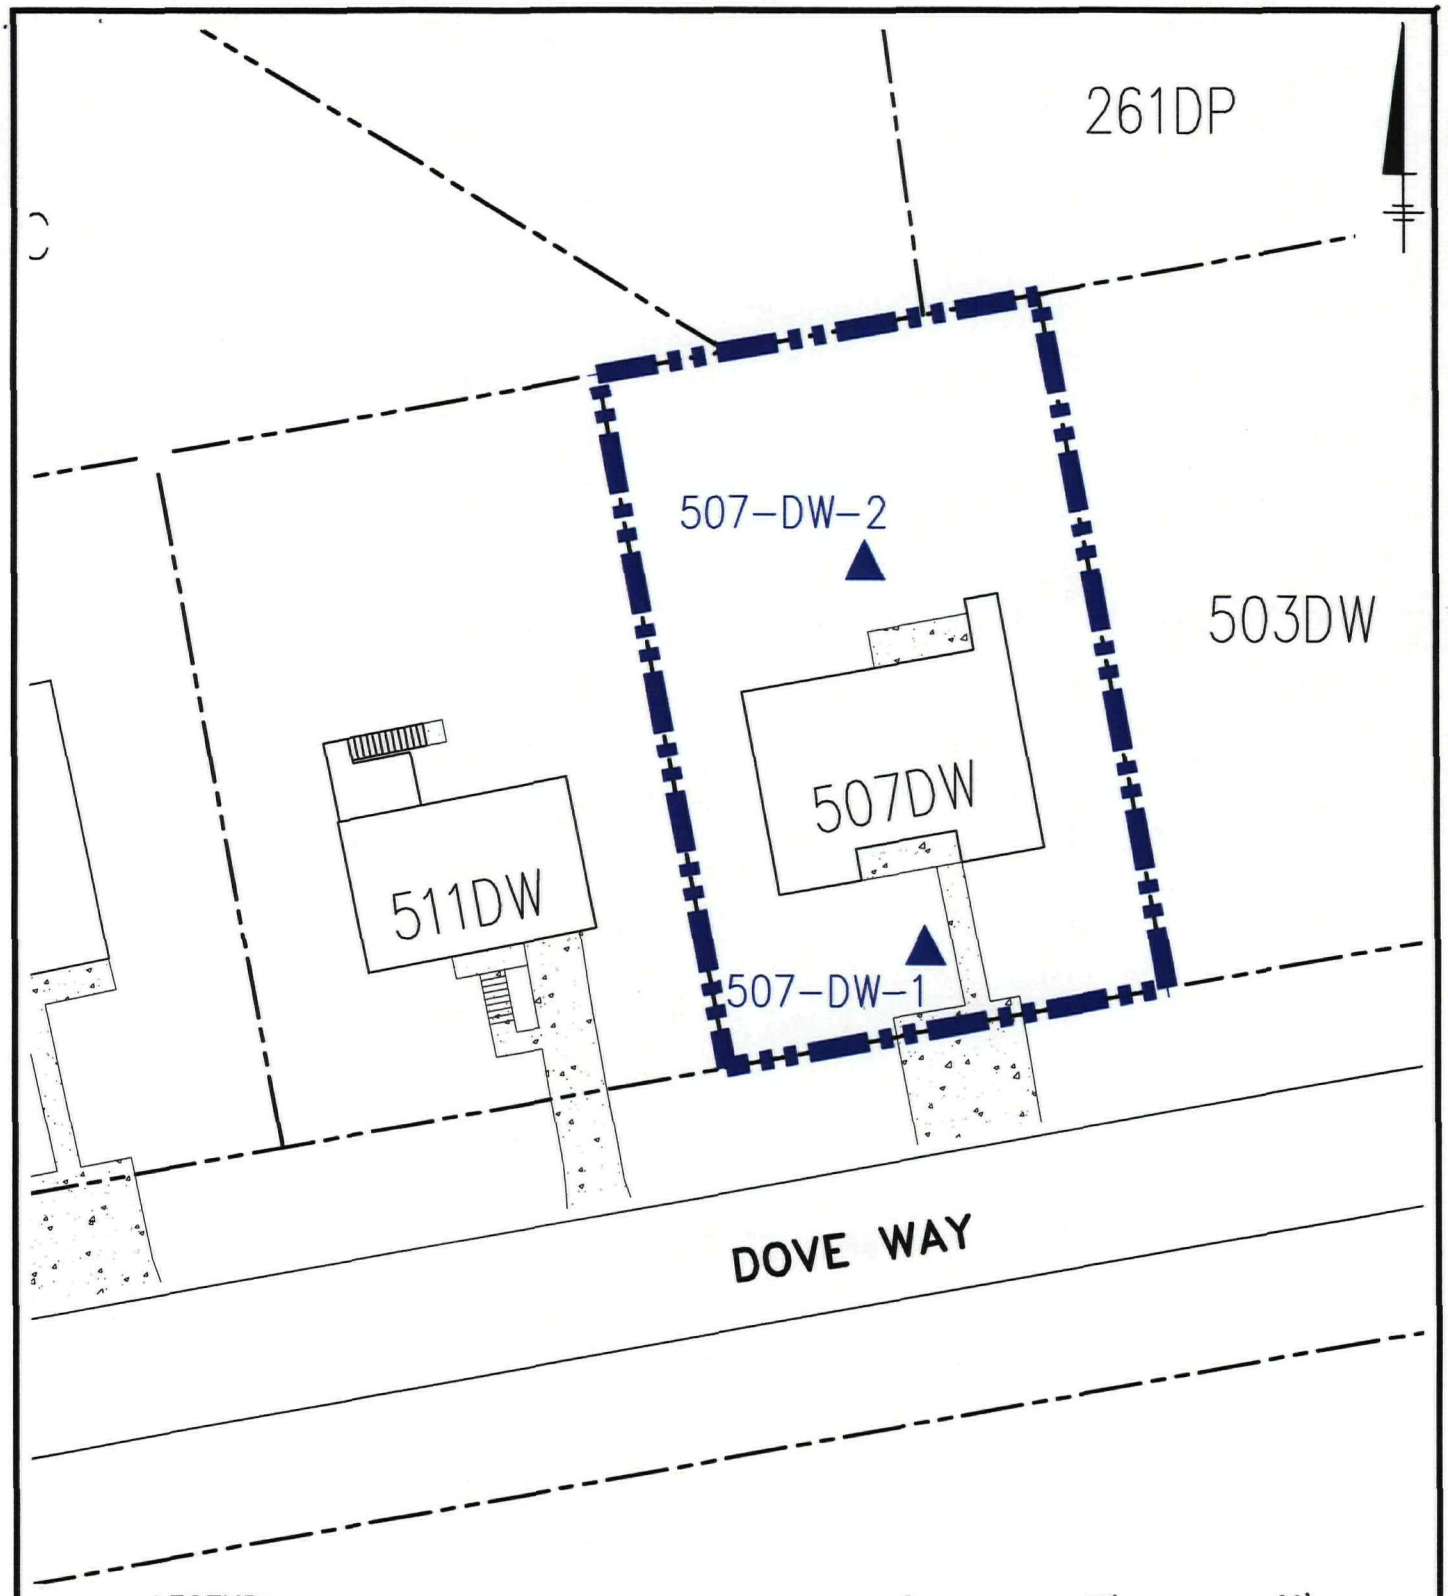

LEGEND:

PROPERTY LINE

CONCRETE

SOIL BORING LOCATION

0 30' 60'

GRAPHIC SCALE

EXXONMOBIL
VCC – SOCIAL CIRCLE, GEORGIA

SAMPLE LOCATION MAP FOR 507 DOVE WAY

BBL
BLASLAND, BOUCK & LEE, INC.
engineers, scientists, economists

FIGURE
507DW

X: 85533X0P, X02.DWG
P: PLT-AP1
10/31/05 CAR-85-LEE
R: \CURRENT\OTHER\85533004\PR\85533G61.DWG

Attachment

BBL®
BLASLAND, BOUCK & LEE, INC.
engineers, scientists, economists

Attachment 1
Photographs of 507 Dove Way Social Circle, GA

507 Dove Way, southern edge looking north.

507 Dove Way, southern edge looking north.

Attachment 1
Photographs of 507 Dove Way Social Circle, GA

507 Dove Way, eastern edge looking north.

507 Dove Way, eastern edge looking northwest.

Attachment 1
Photographs of 507 Dove Way Social Circle, GA

507 Dove Way, northern edge looking south.